


Field Report No.:				21	
SP&A Project No: 22.331		Report Date: 1.28.2025		Time: 9:30AM	
Project: Gales Ferry School (Name & Location) 1854 CT-12 Gales Ferry, CT 06335 General Contractor: The Imperial Company, Inc.					
Weather		Site Conditions		Day of Week	
☐ Temp. Range: 238° ☒ Clear ☐ Rain ☐ Foggy ☐ Warm ☐ Overcast ☐ Snow ☐ Cold ☐ Hot		☒ Clear ☐ Dusty ☐ Muddy ☐ Windy ☐ Other		☐ Monday ☐ Thursday ☒ Tuesday ☐ Friday ☐ Wednesday ☐ Saturday	
Type of Work Observed Being Performed					
1	☐ Site work	7	☐ General Trades/Drywall	13	☐ Specialties/ Food Service
2	☐ Demolition	8	☐ Windows & Doors	14	☐ Elevators
3	☐ Concrete	9	☐ Roofing	15	☐ Plumbing
4	☐ Masonry	10	☐ Flooring	16	☐ HVAC
5	☐ Steel/Misc. Metals	11	☐ Pool	17	☐ Electrical
6	☐ Carpentry/Casework/ Mill Work	12	☐ Painting/Interior Finishes	18	☐ Temperature Controls/BMS
19	☐ Sprinkler	20	☒ Finish metal	21	☐ Iron workers
		22	☐ Tester (Tri-state)	23	☐ Audio Vis/Low Volt
		24	☐ Other:		
Work Performed at time of site visit:					
- Approximate number of workers on site – 4 - Assisting SPA for verification of the length of fasteners on Roof A & D - After verification workers are in the process of installing miscellaneous metals, panels & snow guards.					
General Remarks:					
- <i>Past issues that need to be resolved</i> - Panels that were installed and have short screws that need to be replaced need to be observed for the correct screw length by Garland & SPA in areas where the underside decking is not visible. See attached photo. - <i>Past issues that need to be resolved</i> - Roof A – Gable end of walkway cover needs the lower 8" of the vertical panels (all three sides) removed for investigation of how to secure the new vertical panels to the existing structure and height requirements. Imperial to remove material for exploration. - <i>Past issues that need to be resolved</i> - At the gable end of the walkway roof, Garland needs to produce a drawing eliminating the current cricket for better flow of the rainwater. Currently the water hits vertical end points at both sides of the cricket. - <i>Past issues that need to be resolved</i> - Garland needs to produce a design for where the rake boards meet with the roof at one of the gable roofs. See attached photo. - <i>Past issues that need to be resolved</i> - Garland needs to produce a design for the rakes where there is not enough structure to support the vertical clip.					
Visitors:					
- None.					
Construction Administrator: Steven June				1/28/25	
(Print Name)				(Signature)	
				(Date)	
Copies To:	☐ CA	☐ Architect	☒ Contractor	☒ Owners	

Areas of observation (see attached pages) –

Roof A - West Elevation –

Locations marked as locations 7 & 8 were found to have 8" screws and were picked by random by SPA for verification. Other locations were reviewed by Garland -

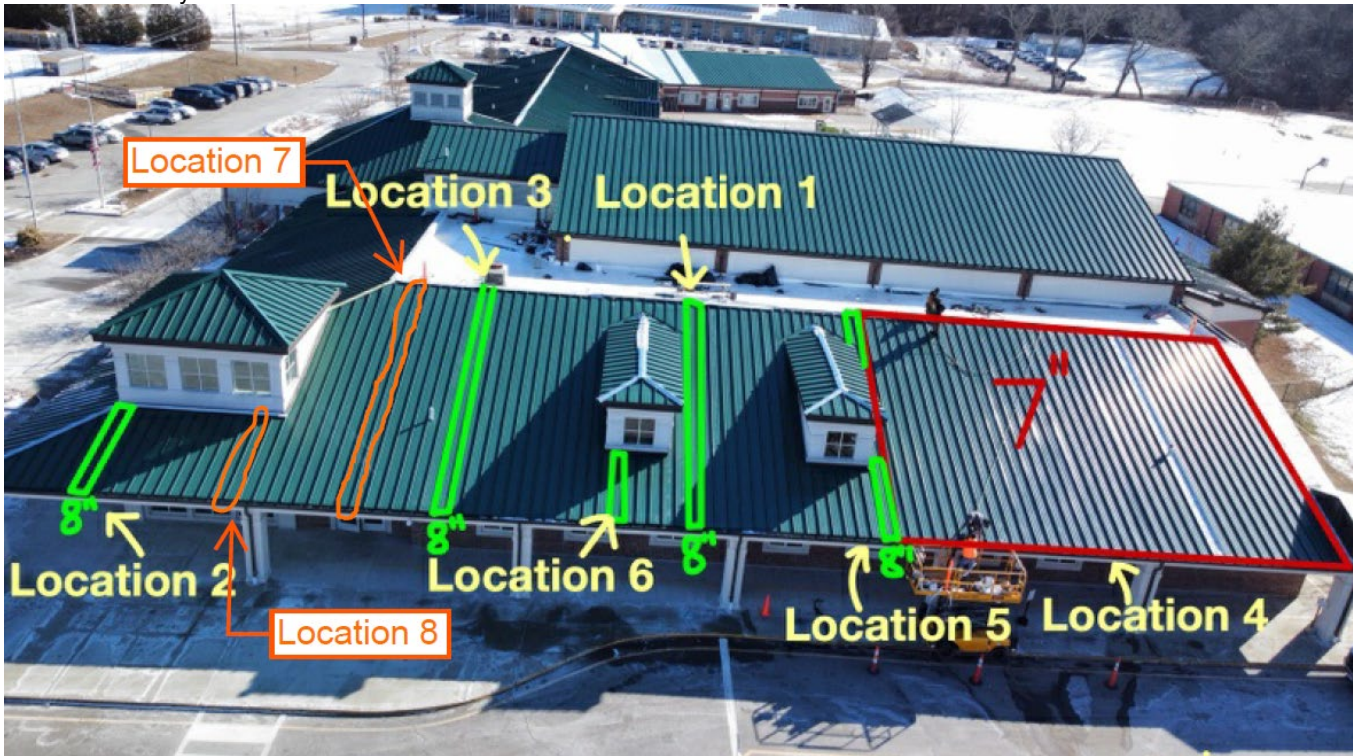

Roof A - North Elevation –

Locations marked as locations 1 & 3 were found to have 8" screws and locations 2 & 4 were found to have 7" screws and were picked by random by SPA for verification. Area in red below needs the panels removed & reinstalled with 8" screws.



Roof D - North Elevation –

Location marked as location 5 was found to have 8" screws and was picked by random by SPA for verification -



Roof plan

