

## Silver Petrucelli + Associates 3190 Whitney Avenue | Hamden CT 06518 311 State Street | New London CT 06320 203 230 9007 silverpetrucelli.com

## **Field** Report Page 1 of 5

Field Report No.:													ort No.: 18		
SP&A Project No:			22.331					Report Date: 1.10.2025						Time: 9:30AM	
Project: Gales Ferry School (Name & Location) 1854 CT-12 Gales Ferry, CT 06335															
			General The Impe				Inc								
		Weat		Ellal	COIII	parry,								of Week	
☐ Temp. Range: 38°						⊠ Clear	☐ Dusty				☐ Monday ☐ Thursday				
	Clear	☐ Rain	☐ Foggy ☐ Warm			☐ Muddy			Windy	☐ Tuesday			⊠ Friday		
	Overca	ast ☐ Snow	□ Cold □ Hot			☐ Other			-	☐ Wednesday			☐ Saturday		
Type of Work Observed Being Performed															
1		Site work	ite work		7  Gene		ral es/Drywall	13		Specialties/	Food	19		Sprinkler	
2		Demolition					ows & Doors	14		Elevators		20	×	Finish metal	
3				9			•	15		Plumbing		21		Iron workers	
4					10 🗆 Floor		ing	16		HVAC		22	<u> </u>	Tester (Tri-state)	
5 6	·   <del>-</del>			11 □ Pool 12 □ Painti			ing/Interior	17 18		Electrical Temperature		23 24	<u> </u>	Audio Vis/Low Volt Other:	
Mill Work			OIN	Finish				10		Controls/BM		24	ш	Other.	
- A	Work Performed at time of site visit:  - Approximate number of workers on site – 4 - Installing trim work on the "tower" of roof A. See attached photo.														
General Remarks:															
<ul> <li>Panels that were installed and have short screws that need to be replaced need to be observed for the correct screw length by Garland &amp; SPA in areas where the underside decking is not visible.</li> <li>Roof A – Gable end of walkway cover needs the lower 8" of the vertical panels (all three sides) removed for investigation of how to secure the new vertical panels to the existing structure and height requirements. Imperial to remove material for exploration.</li> <li>At the gable end of the walkway roof, Garland needs to produce a drawing eliminating the current cricket for better flow of the rainwater. Currently the water hits vertical end points at both sides of the cricket.</li> <li>Garland needs to produce a design for where the rake boards meet with the roof at one of the gable roofs. See attached photo.</li> <li>Garland needs to produce a design for the rakes where there is not enough structure to support the vertical clip. See attached snippet.</li> </ul>															
Visitors:															
- None.															
c	onstr	uction Administrat	tor:		s	teven	June Jame)			(Sigr	nature)			1/16/25 (Date)	
Copies To: ☐ CA ☐ Architect ☐ Contractor ☐ Owners															

PHOTOS (see attached photos);



ARCHITECTS ENGINEERS INTERIORS



Roof E – Additional peal & stick to be applied week of 1/13-17 on the triangular roof.



Area for storage of the workdays material.


ARCHITECTS ENGINEERS INTERIORS








ARCHITECTS ENGINEERS INTERIORS

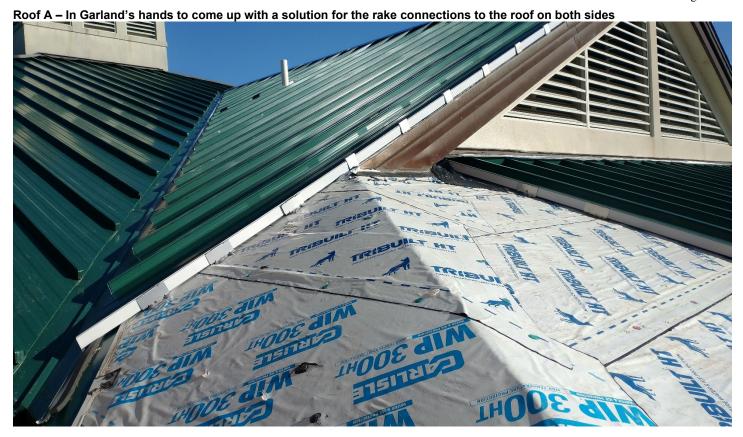

Garland needs to produce a design for the rakes on the entire job where there is not enough structure to support the new vertical clip

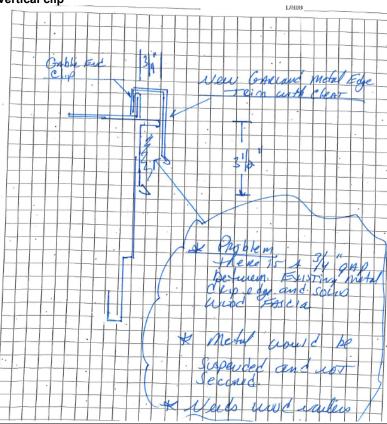

## Report Page 5 of 5

## Roof plan

