



Field Report No.:										18	
SP&A Project No: 22.331					Report Date: 1.10.2025			Time: 9:30AM			
Project: Gales Ferry School (Name & Location) 1854 CT-12 Gales Ferry, CT 06335 General Contractor: The Imperial Company, Inc.											
Weather				Site Conditions				Day of Week			
☐ Temp. Range: 38°				☒ Clear				☐ Dusty			
☒ Clear				☐ Muddy				☐ Windy			
☐ Rain				☐ Other				☐ Monday			
☐ Foggy								☐ Tuesday			
☐ Warm								☒ Friday			
☐ Overcast								☐ Wednesday			
☐ Snow								☐ Saturday			
☐ Cold											
☐ Hot											
Type of Work Observed Being Performed											
1	☐	Site work	7	☐	General Trades/Drywall	13	☐	Specialties/ Food Service	19	☐	Sprinkler
2	☐	Demolition	8	☐	Windows & Doors	14	☐	Elevators	20	☒	Finish metal
3	☐	Concrete	9	☐	Roofing	15	☐	Plumbing	21	☐	Iron workers
4	☐	Masonry	10	☐	Flooring	16	☐	HVAC	22	☐	Tester (Tri-state)
5	☐	Steel/Misc. Metals	11	☐	Pool	17	☐	Electrical	23	☐	Audio Vis/Low Volt
6	☐	Carpentry/Casework/ Mill Work	12	☐	Painting/Interior Finishes	18	☐	Temperature Controls/BMS	24	☐	Other:
Work Performed at time of site visit: - Approximate number of workers on site – 4 - Installing trim work on the “tower” of roof A. See attached photo.											
General Remarks: - Panels that were installed and have short screws that need to be replaced need to be observed for the correct screw length by Garland & SPA in areas where the underside decking is not visible. - Roof A – Gable end of walkway cover needs the lower 8” of the vertical panels (all three sides) removed for investigation of how to secure the new vertical panels to the existing structure and height requirements. Imperial to remove material for exploration. - At the gable end of the walkway roof, Garland needs to produce a drawing eliminating the current cricket for better flow of the rainwater. Currently the water hits vertical end points at both sides of the cricket. - Garland needs to produce a design for where the rake boards meet with the roof at one of the gable roofs. See attached photo. - Garland needs to produce a design for the rakes where there is not enough structure to support the vertical clip. See attached snippet.											
Visitors: - None.											
Construction Administrator: Steven June (Print Name)										1/16/25 (Date)	
Copies To: ☐ CA ☐ Architect ☒ Contractor ☒ Owners											

PHOTOS (see attached photos);

Trim work in progress on the “tower” of roof A



Roof E – Additional peel & stick to be applied week of 1/13-17 on the triangular roof.



Area for storage of the workdays material.




Roof A – Panels to be completed the week of 1/13 -17



Roof A – In Garland's hands to come up with a solution for the rake connections to the roof on both sides



Garland needs to produce a design for the rakes on the entire job where there is not enough structure to support the new vertical clip

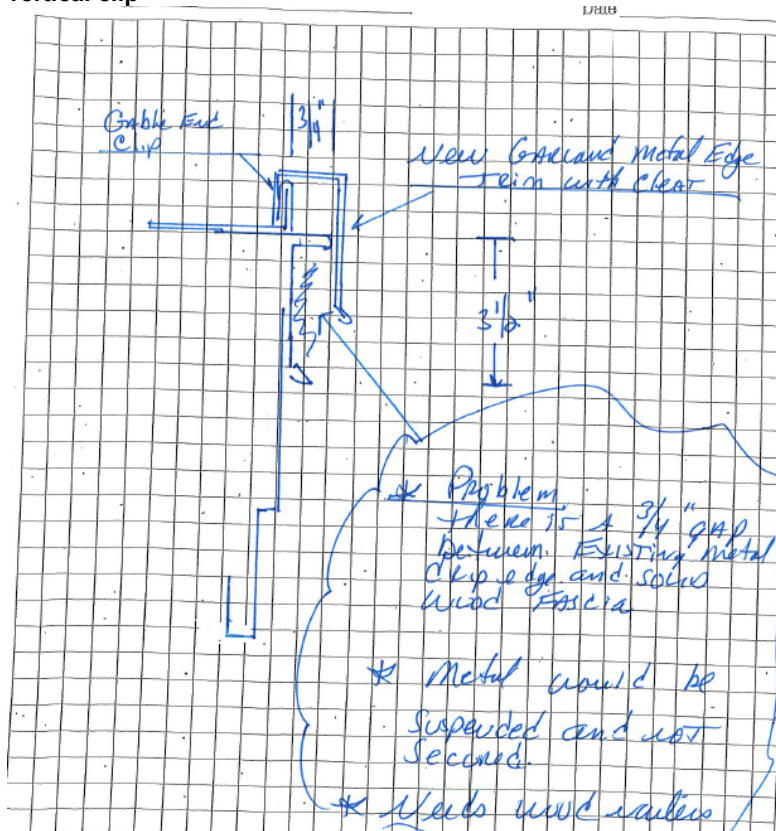

Roof plan

