

Field Report No.:				18	
SP&A Project No: 22.331			Report Date: 1.10.2025		
			Time: 9:30AM		
Project: Gales Ferry School (Name & Location) 1854 CT-12 Gales Ferry, CT 06335					
General Contractor: The Imperial Company, Inc.					
Weather		Site Conditions		Day of Week	
☐ Temp. Range: 38° ☒ Clear ☐ Rain ☐ Foggy ☐ Warm ☐ Overcast ☐ Snow ☐ Cold ☐ Hot		☒ Clear ☐ Dusty ☐ Muddy ☐ Windy ☐ Other		☐ Monday ☐ Thursday ☐ Tuesday ☒ Friday ☐ Wednesday ☐ Saturday	
Type of Work Observed Being Performed					
1	☐ Site work	7	☐ General Trades/Drywall	13	☐ Specialties/ Food Service
2	☐ Demolition	8	☐ Windows & Doors	14	☐ Elevators
3	☐ Concrete	9	☐ Roofing	15	☐ Plumbing
4	☐ Masonry	10	☐ Flooring	16	☐ HVAC
5	☐ Steel/Misc. Metals	11	☐ Pool	17	☐ Electrical
6	☐ Carpentry/Casework/ Mill Work	12	☐ Painting/Interior Finishes	18	☐ Temperature Controls/BMS
19	☐ Sprinkler	20	☒ Finish metal	21	☐ Iron workers
		22	☐ Tester (Tri-state)	23	☐ Audio Vis/Low Volt
		24	☐ Other:		
Work Performed at time of site visit:					
- Approximate number of workers on site – 4 - Installing trim work on the “tower” of roof A. See attached photo.					
General Remarks:					
- Panels that were installed and have short screws that need to be replaced need to be observed for the correct screw length by Garland & SPA in areas where the underside decking is not visible. - Roof A – Gable end of walkway cover needs the lower 8” of the vertical panels (all three sides) removed for investigation of how to secure the new vertical panels to the existing structure and height requirements. Imperial to remove material for exploration. - At the gable end of the walkway roof, Garland needs to produce a drawing eliminating the current cricket for better flow of the rainwater. Currently the water hits vertical end points at both sides of the cricket. - Garland needs to produce a design for where the rake boards meet with the roof at one of the gable roofs. See attached photo. - Garland needs to produce a design for the rakes where there is not enough structure to support the vertical clip. See attached snippet.					
Visitors:					
- None.					
Construction Administrator: Steven June				1/16/25	
(Print Name)				(Date)	
(Signature)					
Copies To:	☐ CA	☐ Architect	☒ Contractor	☒ Owners	

PHOTOS (see attached photos);

Trim work in progress on the “tower” of roof A



Roof E – Additional peel & stick to be applied week of 1/13-17 on the triangular roof.



Area for storage of the workdays material.




Roof A – Panels to be completed the week of 1/13 -17



Roof A – In Garland's hands to come up with a solution for the rake connections to the roof on both sides



Garland needs to produce a design for the rakes on the entire job where there is not enough structure to support the new vertical clip

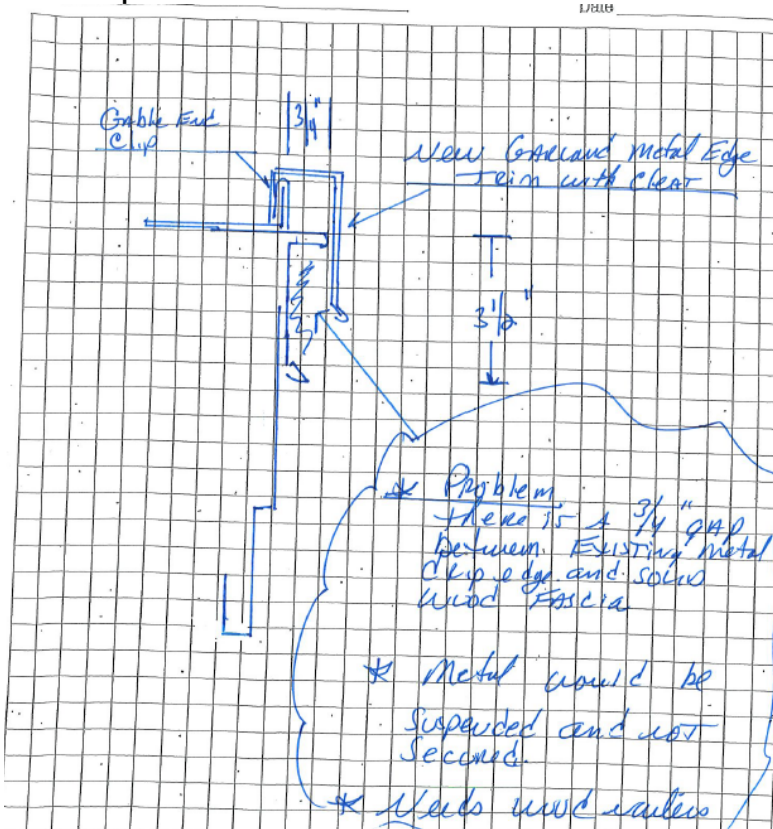

Roof plan

